

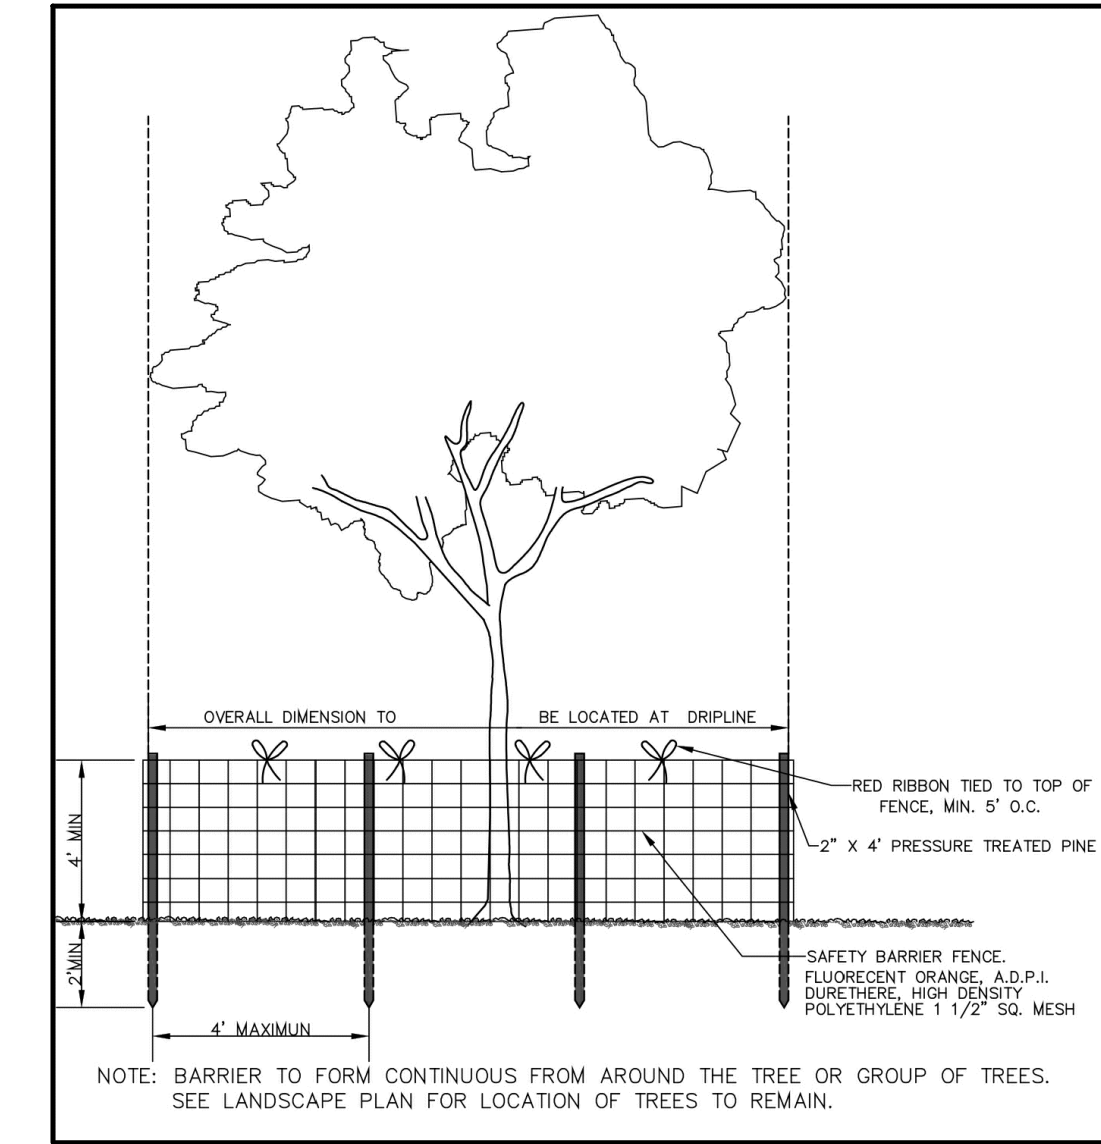


NUMBERS IN CIRCLES SHOW TREES NOTED ON TREE SURVEY BUT REMOVED BEFORE THE LA'S SITE VISIT.
THE SPECIES & DIMENSIONS OF REMOVED TREES COULD NOT BE DETERMINED

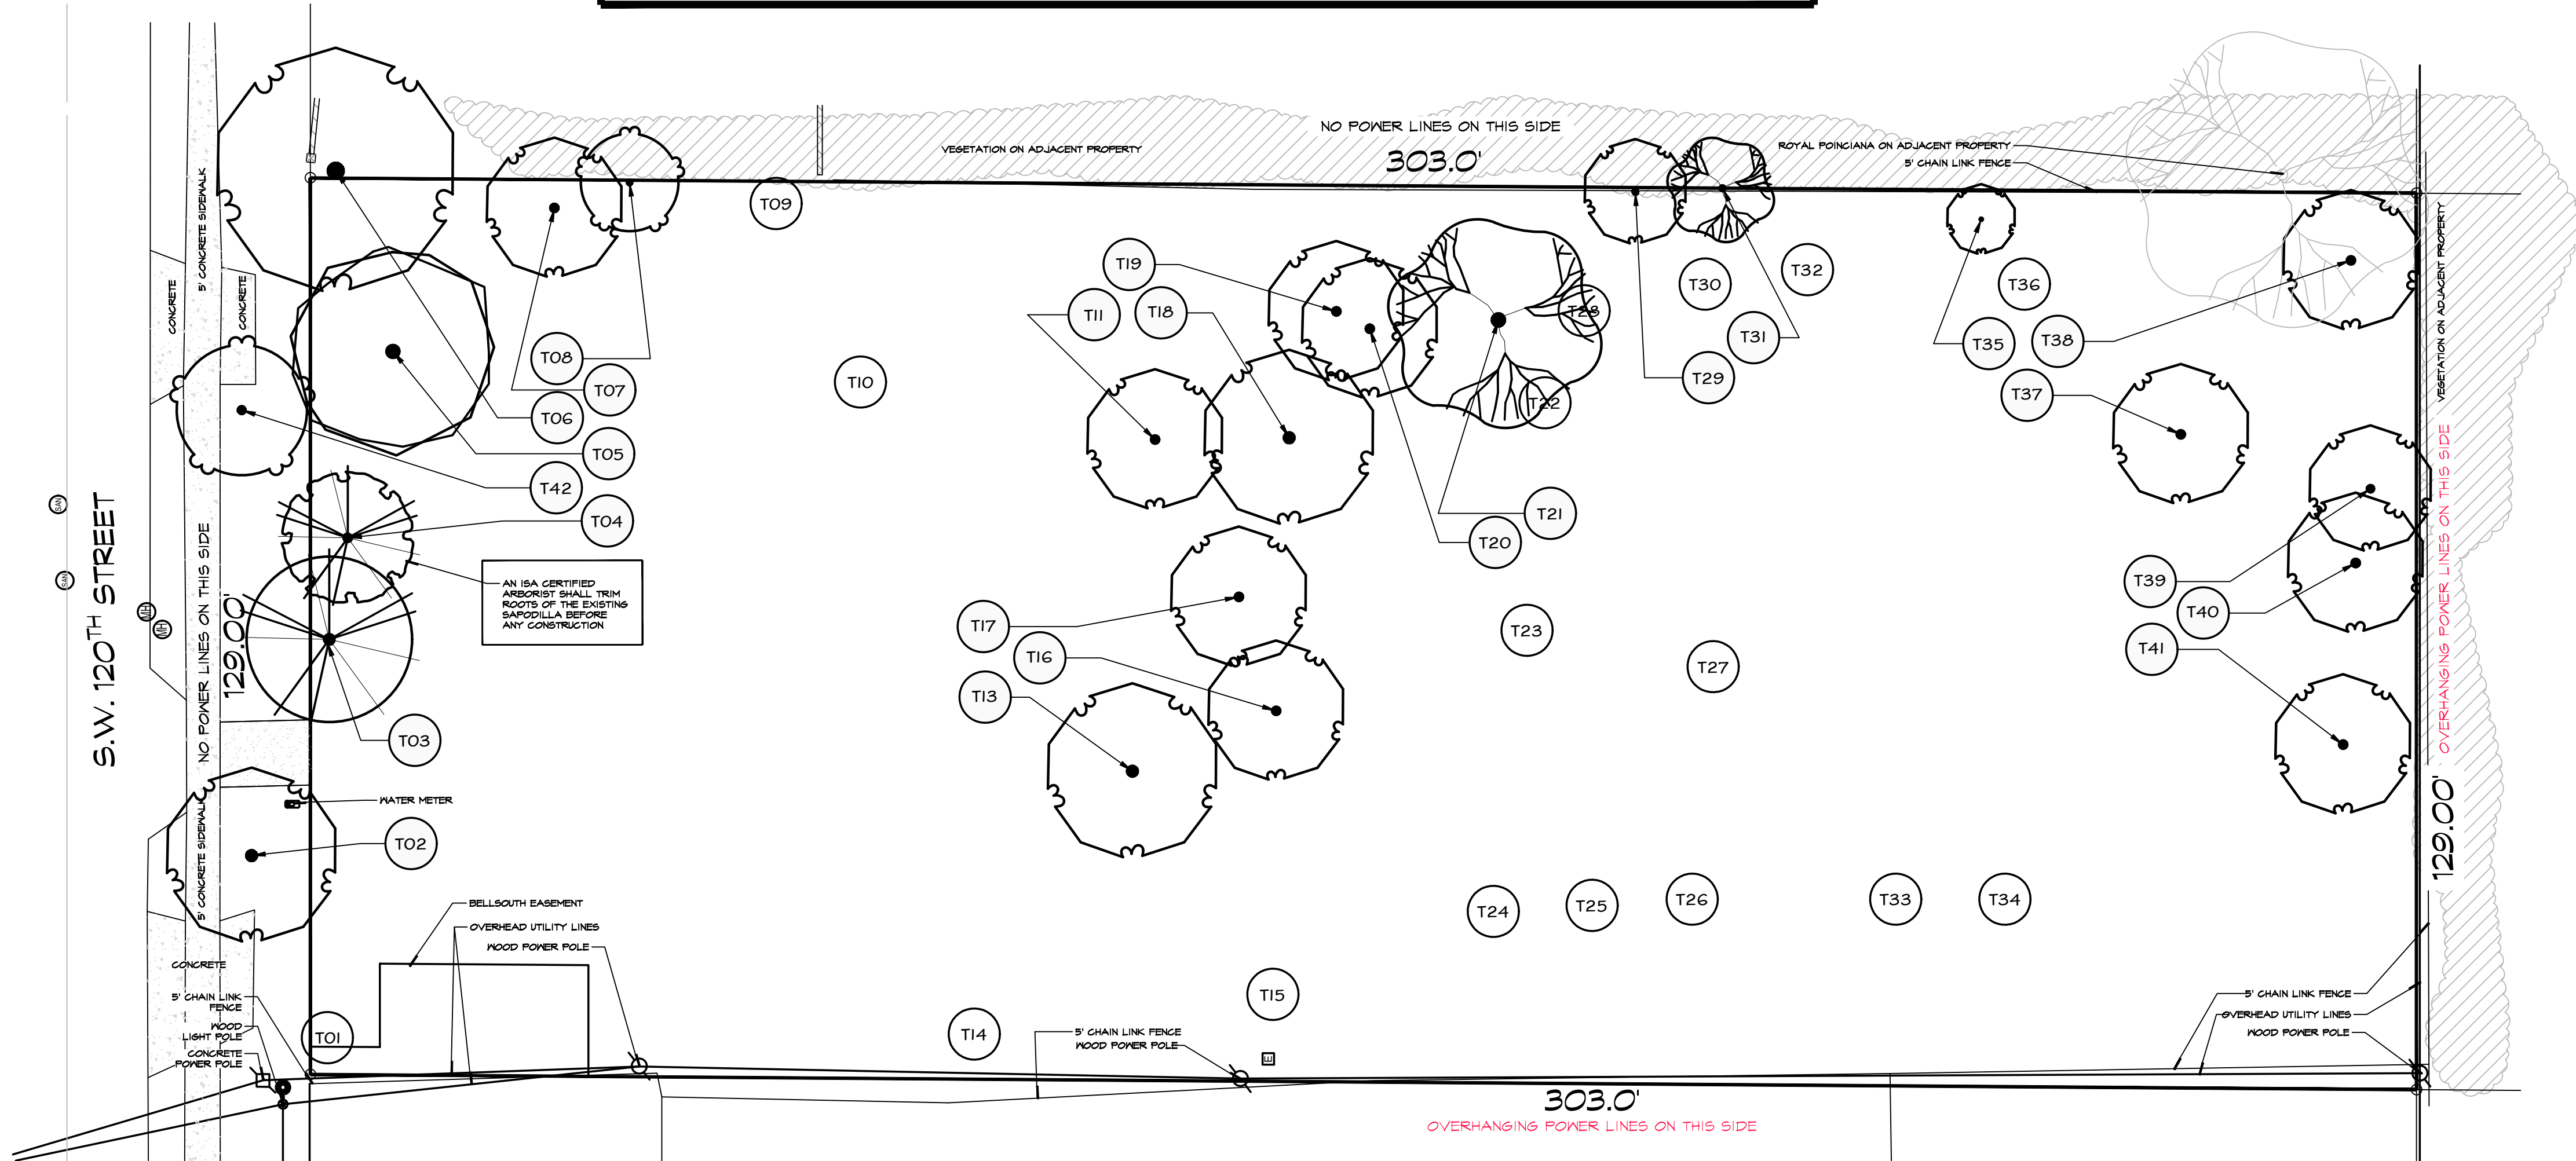

B TREE PROTECTION DETAIL
not to scale

A GENERAL LAYOUT
scale 1/16"=1'-0"

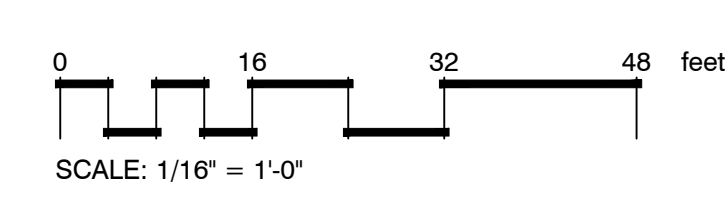


EXISTING TREES								
CODE	BOTANICAL NAME	COMMON NAME	DBH	HEIGHT/CT	CANOPY	CONDITION	NOTES	ACTION
TREES								
T01	Removed	Removed	-					REMOVED
T02	Quercus virginiana	Southern Live Oak	14"	28' OA	25'			TO REMAIN
T03	Bischofia javanica	Bishopwood dbi	12" + 14"	28' OA	25'	Poor		REMOVE
T04	Manilkara zapota	Sapodilla	26"	30'	20'	Poor		TO REMAIN
T05	Bucida buceras	Black Olive	28"	35' OA	30'	Poor		TO REMAIN
T06	Quercus virginiana	Southern Live Oak	N/A	N/A	N/A		OUT OF PROP. LINE	TO REMAIN
T07	Quercus virginiana	Southern Live Oak	not accessible	25' OA	20'			TO REMAIN
T08	Swietenia mahagoni	West Indian Mahogany	not accessible	25' OA	15'	Poor		TO REMAIN
T09	Removed	Removed	-					REMOVED
T10	Removed	Removed	-					REMOVED
T11	Quercus spp	Live Oak	17" + 18", low crotch, double trunk	20' OA	20'	Poor	unbalanced	REMOVE
T12	Removed	Removed	-					REMOVED
T13	Quercus spp	Live Oak	30"	28' OA	25'	Fair/poor	polypores/mushrooms growing on trunk	REMOVE
T14	Removed	Removed	-					REMOVED
T15	Removed	Removed	-					REMOVED
T16	Quercus spp	Live Oak	15"	25' OA	20'	Fair		REMOVE
T17	Quercus spp	Live Oak	14" + 18", low crotch, double trunk	25' OA	20'	Poor	unbalanced	REMOVE
T18	Quercus spp	Live Oak	20"	25' OA	25'	Fair	unbalanced	REMOVE
T19	Quercus spp	Live Oak	21"	28' OA	20'	Fair	unbalanced	REMOVE
T20	Quercus spp	Live Oak	12"	25' OA	20'	Poor	unbalanced, leaning	REMOVE
T21	Delonix regia	Royal Poinciana	23"	30' OA	30'	Poor	damaged trunk	REMOVE
T22	Removed	Removed	-					REMOVED
T23	Removed	Removed	-					REMOVED
T24	Removed	Removed	-					REMOVED
T25	Removed	Removed	-					REMOVED
T26	Removed	Removed	-					REMOVED
T27	Removed	Removed	-					REMOVED
T28	Removed	Removed	-					REMOVED
T29	Quercus spp	Live Oak	9"	24' OA	15'	Poor	on property line	TO REMAIN
T30	Removed	Removed	-					REMOVED

EXISTING TREES								
CODE	BOTANICAL NAME	COMMON NAME	DBH	HEIGHT/CT	CANOPY	CONDITION	NOTES	ACTION
TREES								
T31	Delonix regia	Royal Poinciana	-	25' OA	15'		need a closer evaluation after clearing	REMOVE
T32	Removed	Removed	-				volunteer; in chain link fence	REMOVED
T33	Removed	Removed	-					REMOVED
T34	Removed	Removed	-					REMOVED
T35	Quercus spp	Live Oak	8"	22' OA	10'	Poor	unbalanced, leaning	REMOVE
T36	Removed	Removed	-					REMOVED
T37	Quercus spp	Live Oak	22"	28' OA	20'	Fair	unbalanced, leaning	TO REMAIN
T38	Quercus spp	Live Oak	17"	30' OA	20'	Fair		TO REMAIN
T39	Quercus spp	Live Oak	12"	24' OA	18'	Fair		TO REMAIN
T40	Quercus spp	Live Oak	18"	28' OA	20'	Fair		TO REMAIN
T41	Quercus spp	Live Oak	19.5"	25' OA	20'	Fair		TO REMAIN
T42	Swietenia mahagoni	West Indian Mahogany	20"	28' OA	20'	Poor	leaning over road	REMOVE




IF YOU DIG FLORIDA...
CALL US FIRST!
1-800-432-4770
SUNSHINE STATE OECALLING
OF FLORIDA, INC.
IT'S THE LAW

NOTE:
INDICATED UTILITIES ARE APPROXIMATE.
CONTRACTOR IS RESPONSIBLE FOR VERIFICATION
OF ALL UTILITIES ON SITE PRIOR TO
COMMENCEMENT OF ANY WORK.
LANDSCAPE ARCHITECT ASSUMES NO LIABILITY
FOR UTILITY DAMAGE.

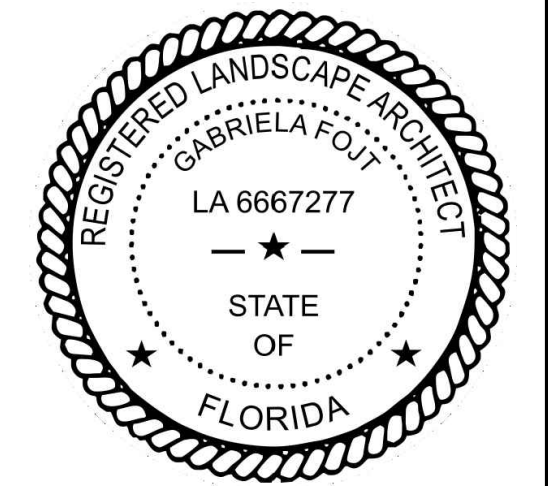

The Mirror of Paradise
Gabriela Fojt
LA 6667277
LC 26000628
2700 E Oakland Park Blvd
Suite C
Fort Lauderdale
FL 33306
c (954) 478 3064
www.florida-landscape.com
gabriela@themirrorofparadise.com

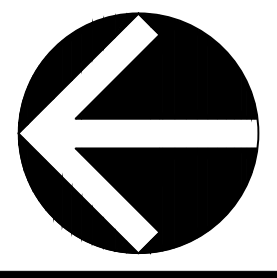

SCALE 1/16"=1'-0"
DESIGNED BY GF
DRAWN BY KM,GF
CHECKED BY GF
CAD DWG.
DATE 01.21.2025
REVISIONS

8100 S.W. 120th STREET
PINECREST
FL 33156

REMOVAL PLAN, EXISTING TREES LIST, TREE PROT. DETAIL